

Notice



☐ CORRECTION
☐ SERVICE FLASH

☒ PRODUCTION CHANGE
☐ ADD INFORMATION

FILE NO.

REVISION 1

Please add this notice to the Service Manual listed below.

Category: **COLOR TELEVISION**

Date: **May / 15 / 2007**

Model: **DP15647**

Effective from : Chassis No. **P15647-01**

Destination: **U.S.A. / CANADA**

REF. No. **SM780138**

NOTE: Match the Chassis No. on the unit's back cover with the Chassis No. in the Service Manual. **If the Service Manual Chassis No. does not match the unit's**, additional Service Literature is required. This chassis is similar to Chassis No. P15647-00. Only the **difference** Service Information is given in this manual. For detailed Service Information, refer to the **Original** Service Manual and **Notices** for Chassis No. P15647-00 used in Model DP15647 (SM780138).

Servicing should be performed by only trained and qualified service personnel.

1. IN THE SERVICE ADJUSTMENTS

PAGE 4 ON-SCREEN SERVICE MENU

Item No. **088 OP2 Data** should be changed from **00h** to **0Ch** in the table and in **Note 2**.

2. IN THE CHASSIS ELECTRICAL PARTS LIST MAIN PC BOARD AND MISCELLANEOUS


The reason for change.

A : Misprint B : Quality Reliability C : Standardization
D : Design E : Add as a possible sub F : Schematic location change
G : Purchasing Request

Page & Section	Schematic Location		Part No.	Description	Q'ty	Interchangeability	Reason
Page 21 Chassis Electrical Parts List	R1263	Old	RGFR000ZTCANL	MT-GLAZE 0.000 JA 1/10W	1	NO	D
		New	RGF1001JTCANL	MT-GLAZE 1K JA 1/10W	1	NO	
	R1266	Old	RGF2201JTCANL	MT-GLAZE 2.2K JA 1/10W	1	NO	D
		New	RGF1001JTCANL	MT-GLAZE 1K JA 1/10W	1	NO	
	R1269	Old	RGFR000ZTCANL	MT-GLAZE 0.000 JA 1/10W	1	NO	D
		New	RGF1001JTCANL	MT-GLAZE1K JA 1/10W	1	NO	
	R1271	Old	RGF2201JTCANL	MT-GLAZE 2.2K JA 1/10W	1	NO	D
		New	RGF1001JTCANL	MT-GLAZE 1K JA 1/10W	1	NO	
Page 22 Chassis Electrical Parts List	R1856	Old	N/A	NOT USED	0	NO	D
		New	RGF4702JTCANL	MT-GLAZE 47K JA 1/10W	1	NO	
	R1857	Old	RGFR000ZTCANL	MT-GLAZE 0.000 JA 1/10W	1	NO	D
		New	NA	NOT USED	0	NO	
	R1858	Old	N/A	NOT USED	0	NO	D
		New	RGF4702JTCANL	MT-GLAZE 47K JA 1/10W	1	NO	
	R1859	Old	RGFR000ZTCANL	MT-GLAZE 0.000 JA 1/10W	1	NO	D
		New	NA	NOT USED	0	NO	
Page 24 Chassis Electrical Parts List	A001	Old	1AA0B10N222F0	ASSY, PWB, MAIN	1	NO	D
		New	1AA0B10N222H0	ASSY, PWB, MAIN	1	NO	
	△EL901	Old	1AV4T40B83400	LCD (CLAA150XP03)	1	NO	D
		New	1AV4T40B84200	LCD (CLAA150XP01Q)	1	NO	
	△U901	Old	1AV4U20C09100	UNIT, INVERTER-POWER	1	NO	D
		New	1AV4U20C11100	UNIT, INVERTER-POWER	1	NO	

3. IN THE SCHEMATIC DIAGRAMS AND PARTS LIST

Add the following parts to the main pc board schematic diagram and parts list.

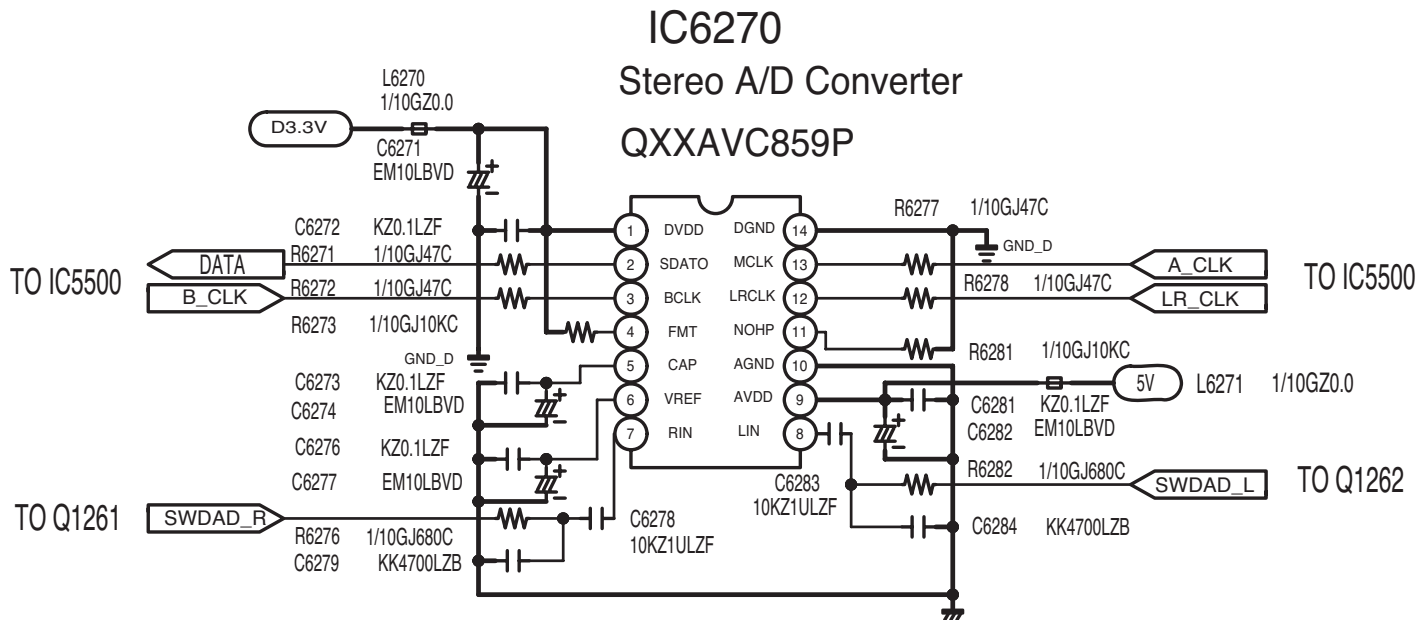

Schematic Location	Part No.	Description
--------------------	----------	-------------

CAPACITORS

C6271	CEXLB1H100VDN	ELECT	10U M	50V
	CEXLB1H100WAN	ELECT	10U M	50V
C6272	CK1H104ZLZFN	CERAMIC	0.1U Z	50V
C6273	CK1H104ZLZFN	CERAMIC	0.1U Z	50V
C6274	CEXLB1H100VDN	ELECT	10U M	50V
	CEXLB1H100WAN	ELECT	10U M	50V
C6276	CK1H104ZLZFN	CERAMIC	0.1U Z	50V
C6277	CEXLB1H100VDN	ELECT	10U M	50V
	CEXLB1H100WAN	ELECT	10U M	50V
C6278	CK1A105ZLZFN	CERAMIC	1U Z	10V
C6279	CK1H472KLZBN	CERAMIC	4700P K	50V
C6281	CK1H104ZLZFN	CERAMIC	0.1U Z	50V
C6282	CEXLB1H100VDN	ELECT	10U M	50V
	CEXLB1H100WAN	ELECT	10U M	50V
C6283	CK1A105ZLZFN	CERAMIC	1U Z	10V
C6284	CK1H472KLZBN	CERAMIC	4700P K	50V

INTEGRATED CIRCUITS

IC6270	QXXAVC859---P	IC WM8738GED/RV
--------	---------------	-----------------

COILS

L6270	RGFR000ZTAANL	MT-GLAZE	0.000 ZA	1/10W
L6271	RGFR000ZTAANL	MT-GLAZE	0.000 ZA	1/10W

Schematic Location	Part No.	Description
--------------------	----------	-------------

RESISTORS

R6271	RGF47R0JTANL	MT-GLAZE	47 JA	1/10W
R6272	RGF47R0JTANL	MT-GLAZE	47 JA	1/10W
R6273	RGF1002JTANL	MT-GLAZE	10K JA	1/10W
R6276	RGF6800JTANL	MT-GLAZE	680 JA	1/10W
R6277	RGF47R0JTANL	MT-GLAZE	47 JA	1/10W
R6278	RGF47R0JTANL	MT-GLAZE	47 JA	1/10W
R6281	RGF1002JTANL	MT-GLAZE	10K JA	1/10W
R6282	RGF6800JTANL	MT-GLAZE	680 JA	1/10W

For parts or service contact

Sanyo Manufacturing Corporation
P.O. Box 2000
3333 Sanyo Road
Forrest City, Arkansas 72335-2000

May 2007 SMC

Published in U.S.A.